



**RICHARDS BAY CLEAN AIR
ASSOCIATION
DUST DEPOSITION MONITORING
JUNE 2008**

**Sampling period: 19 May – 20 June 2008
Final Monthly Progress Report**

Contact Person: Q. Hurt
Designation: Managing Director
M. Antoni
Consultant

Address: Richards Bay Clean Air Association
PO Box 10299
Meerensee
3901

Project Leader: H.J. Annegarn
Project Officers: P. Maseloa
T. Masethe
H. Nuwarinda

Address of Testing laboratory: AER
14 Second Avenue
Westdene
Johannesburg

Date of Report: 07 July 2008
Report Number: AER 28.363 M_RBCAA

This document is issued by the Company under its General Conditions of Service accessible at http://www.sgs.com/terms_and_conditions.htm. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein.

Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The findings report on the samples provided by the client and are not intended for commercial or contractual settlement purposes since there is no traceability to any goods in particular. Any dispute on the findings reported hereon shall be settled by comparison of these findings with the subsequent findings made on the sub-samples retained for arbitration purpose. Unless otherwise agreed, samples retention and statute of limitation for claims is three (3) months from issuance of the present document. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law.

1. METHODOLOGY

This project commenced operation in June 2006. Windblown settleable dust (fall-out) is monitored based on the American Society of Testing and Materials standard method for collection and analysis of dustfall (ASTM D1739), with certain modifications. This method employs a simple device consisting of a cylindrical 5l container half-filled with de-ionised water exposed for one calendar month (30 ± 3 days). The water is treated with an inorganic biocide to prevent algal growth in the buckets. The most common reagent used for this is a 5% copper sulphate solution (approximately 1 ml per 3 litre of water bucket).

The bucket stand comprises a ring that is raised above the rim of the bucket to prevent contamination from perching birds (Fig 1). The bucket holder is connected to a 2.1 m galvanized steel pole, which is either directly attached to a fence post or can be attached to a galvanized steel base plate, which is buried to a depth of 500 mm. This allows for a variety of placement options for the fallout samplers. Exposed buckets, when returned to the AER laboratories, are rinsed with deionised water to remove residue from the sides of the bucket, and the bucket contents filtered through a coarse ($>1\text{mm}$) filter to remove insects and other coarse organic detritus. The sample is then filtered through a pre-weighed paper filter to remove the insoluble fraction, or dust fallout. This residue and filter are dried, and gravimetrically analysed to determine the insoluble fraction (dust fallout).

1.1 Operational Aspects

The sampling period was from 19 May to 20 June 2008 and samples were exposed for 32 days. The period complies with the standard exposure period of 30 ± 3 days. Site 1 (Brackenham) recorded no data as the bucket was damaged. No other operational problems were encountered during the June monitoring month and a valid sample return of 92% was achieved. It was reported in the reporting month of

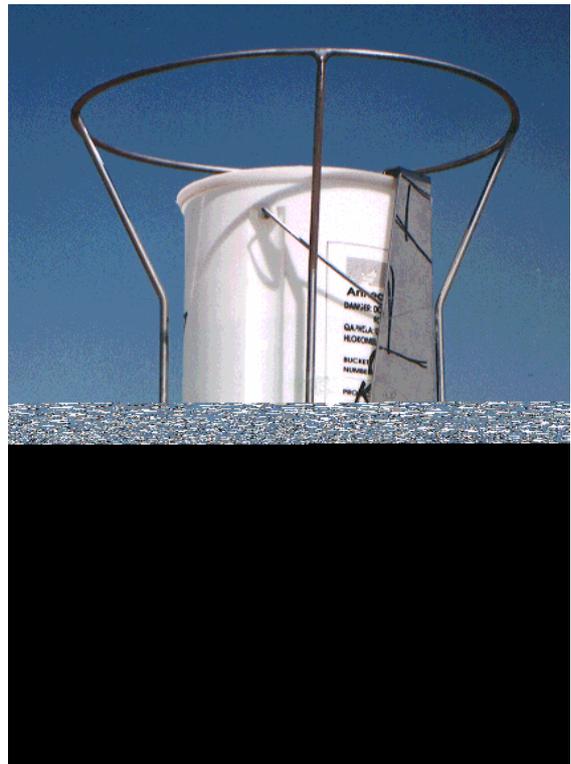


Figure 1: Single bucket monitoring unit, showing sampling bucket with bird ring and security clamp.

April 2008 that there is action blasting near Site 3 (Alton South West) which is still going on.

2. STANDARDS FOR DUST DEPOSITION

The Standards South Africa has published a new set of dustfall standards (SANS 1929:2005). These standards have been used to evaluate the level of dust deposition and are stated in Table 1 and Table 2 below.

2.1 Evaluation criteria for dust deposition

Dust deposition rates shall be expressed in units of $\text{mg}/\text{m}^2/\text{day}$ over a 30-day averaging period. Dust deposition is evaluated against a four band scale as presented in Table 1. The target, action and alert thresholds for ambient dust deposition are indicated in Table 2. Permissible margins of tolerance are outlined in 2.2, and exceptions noted in 2.3.

Table 1: Four-band scale evaluation criteria for dust deposition (SANS 1929:2005).

Band Number	Band Description Label	Dustfall rate (D) ($\text{mg}/\text{m}^2/\text{day}$, 30-day average)	Comment
1	Residential	$D < 600$	Permissible for residential and light commercial
2	Industrial	$600 < D < 1\ 200$	Permissible for heavy commercial and industrial
3	Action	$1\ 200 < D < 2\ 400$	Requires investigation and remediation if two sequential months lie in this band, or more than three occur in a year.
4	Alert	$2\ 400 < D$	Immediate action and remediation required following the first incidence of dustfall rate being exceeded. Incident report to be submitted to relevant authority.

Table 2. Dustfall standards, target, action and alert thresholds for dust deposition (SANS 1929:2005).

Level	Dustfall Rate ($\text{mg}/\text{m}^2/\text{day}$)	Permitted Frequency of Exceedances
Target	300	
Action residential	600	Three within any year, no two sequential months.
Action industrial	1 200	Three within any year not sequential months.
Alert threshold	2 400	None. First exceedance requires remediation and compulsory report to authorities.

2.2 Margin of tolerance

An enterprise may submit a request to the authorities to operate within band 3 (action band), as specified in Table 1, for a limited period, provided that this is essential in terms of the practical operation of the enterprise (for example the final removal of a tailings deposit) and provided that an appropriate control technology is applied for the duration. No margin of tolerance will be granted for operations that result in dustfall rates which fall within band 4 (alert band) as specified in Table 1.

2.3 Exceptions

Dustfalls that exceed the specified rates but that can be shown to be the result of some extreme weather or geological event shall be discounted for the purpose of enforcement and control. Such event might typically result in excessive dustfall rates across an entire metropolitan region, and not be localized to a particular operation. Natural seasonal variations, for example, the naturally windy months each year, will not be considered extreme events for this definition.

2.4 Application of standards

Dust deposition rates recorded at RBCAA are appraised according to the standards published by the Standards South Africa (SANS 1929:2005). Dustfall rates within the RESIDENTIAL and INDUSTRIAL ranges do not result in complaints from the public. ACTION and ALERT ranges, generally result in complaints from the public, and therefore considered to be action levels, at which sources of excessive dust must be investigated (if not known) and suitable mitigation measures instituted.

3. RESULTS

During the June 2008 reporting month, all the monitoring sites recorded dustfall rates within the RESIDENTIAL threshold, except Site 1 (Brackenhams) that recorded no data as the bucket was damaged. Trends of the dust fallout results per site are presented in Appendix A of this report.

4. Recommendations and Actions

- RESIDENTIAL threshold levels were recorded at all the monitoring sites. The results were considered satisfactory as they will not result in community complaints or nuisance. All six of the sites complied with the SANS targets as laid out in section 2.


Regards

J Smith

AER Team leader and Quality Manager

For AER (Pty) Ltd



Report compiled by H.Nuwarinda


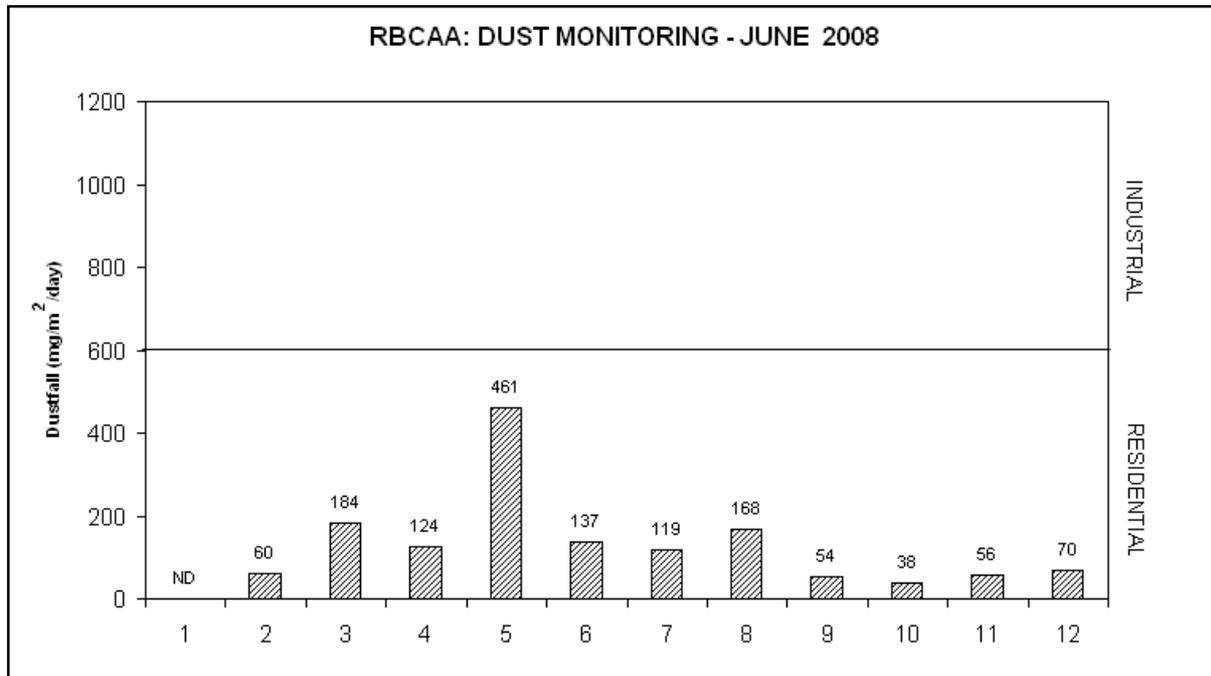
Figure 1: Graph showing results from all sites: June 2008



RAND WATER DUSTFALL MONITORING			Month: June 2008 Sampling period: 19 May – 20 June 2008			
SITE DESCRIPTION	SITE CLASSIFICATION	SITE No.	FILTER CODE	NETT MASS (mg)	No. DAYS	DUST FALLOUT (mg/m ² /day)
Brackenham	RESIDENTIAL	1	RBCAA 08/133	ND	ND	ND
SAPS Garage	RESIDENTIAL	2	RBCAA 08/134	43	32	60
Alton South West	INDUSTRIAL	3	RBCAA 08/135	134	32	184
Harbour West	INDUSTRIAL	4	RBCAA 08/136	90	32	124
CBD(Municipal office)	RESIDENTIAL	5	RBCAA 08/137	334	32	461
Scorpio	INDUSTRIAL	6	RBCAA 08/138	99	32	137
Alton fire station	RESIDENTIAL	7	RBCAA 08/139	87	32	119
Nseleni Municipal office	RESIDENTIAL	8	RBCAA 08/140	122	32	168
Empangeni police station	RESIDENTIAL	9	RBCAA 08/141	40	32	54
Felixton Village	RESIDENTIAL	10	RBCAA 08/142	28	32	38
Arboretum	INDUSTRIAL	11	RBCAA 08/143	41	32	56
Meerensee School	RESIDENTIAL	12	RBCAA 08/144	51	32	70



Comment: ND; No data recorded as the bucket was damaged and not replaced yet.



APPENDIX A RBCAA DUST FALLOUT MONTHLY TIMEPLOTS 2006 – 2008

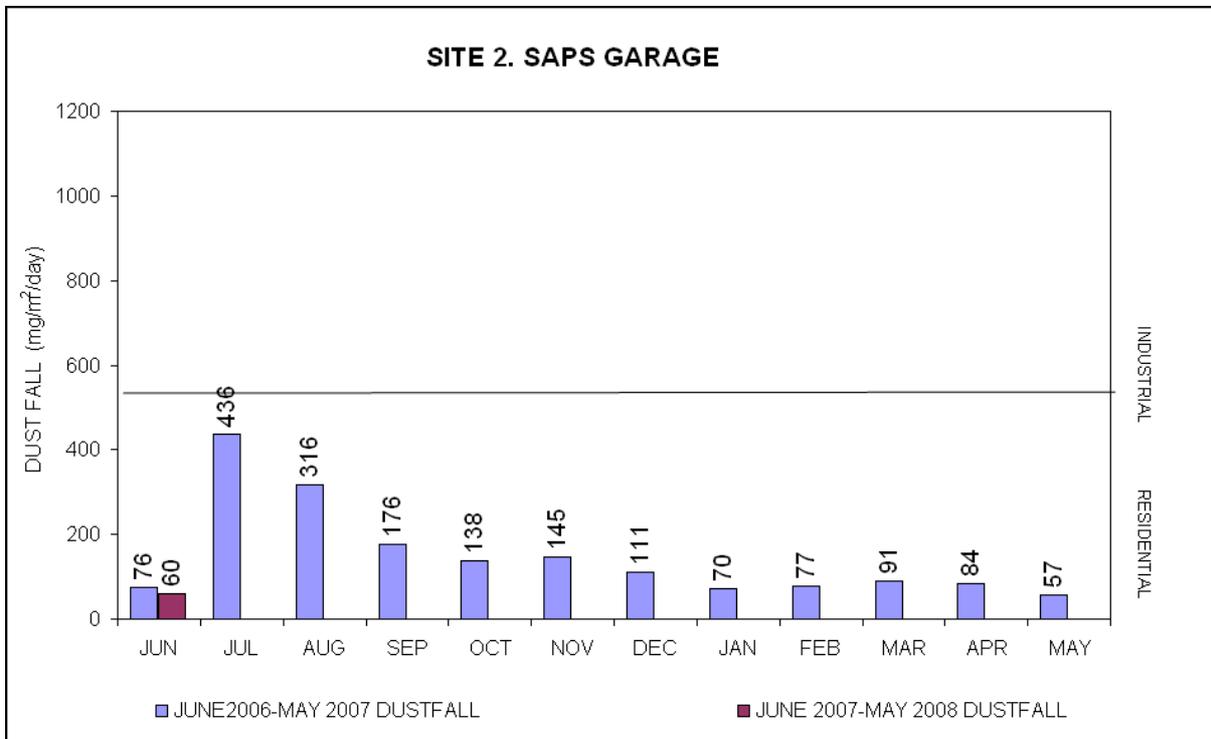
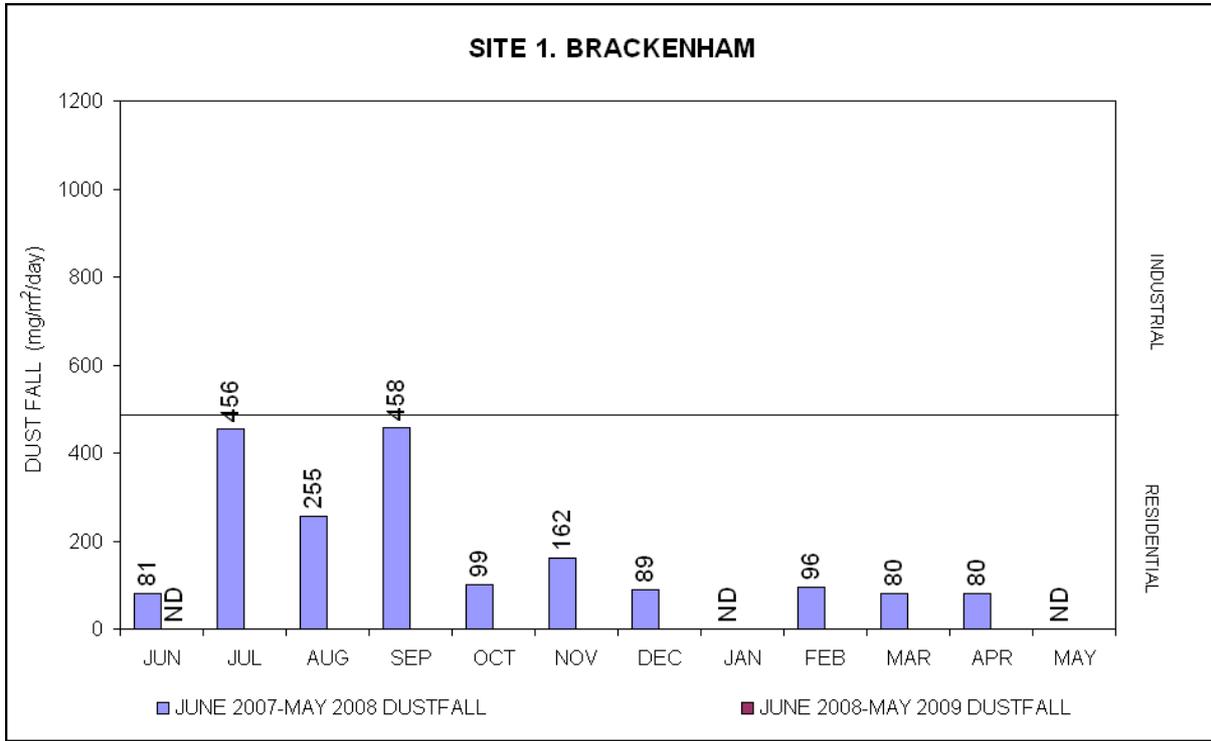


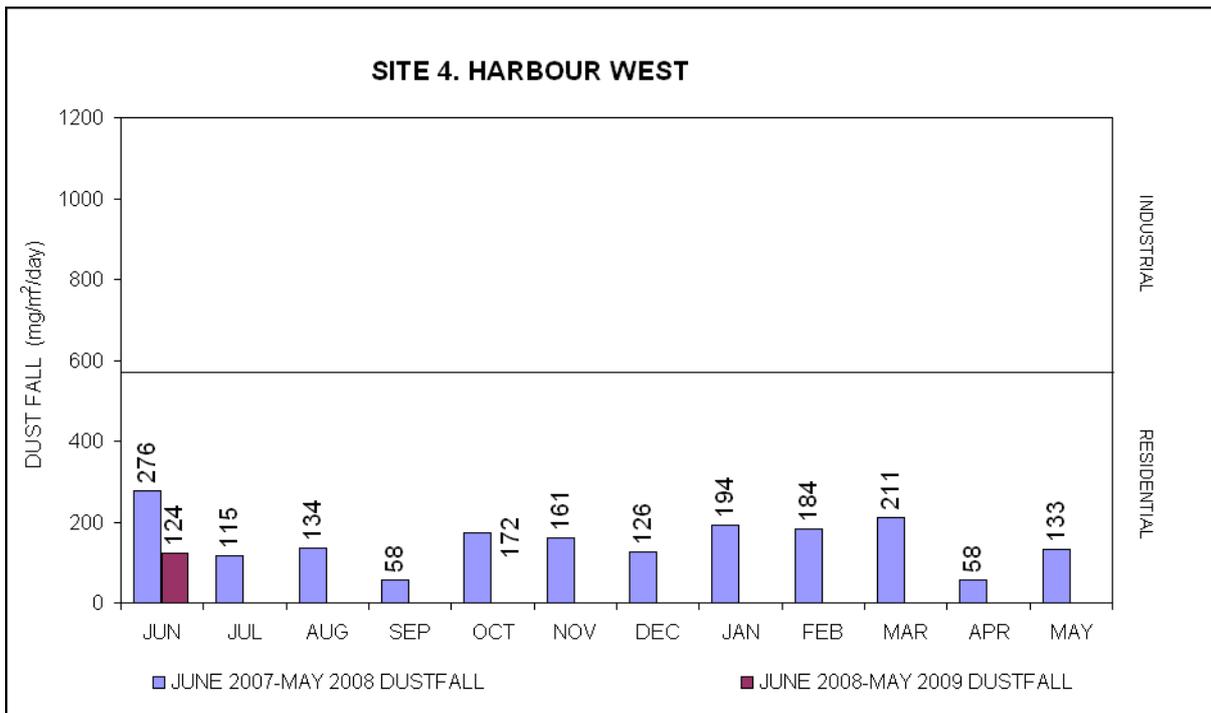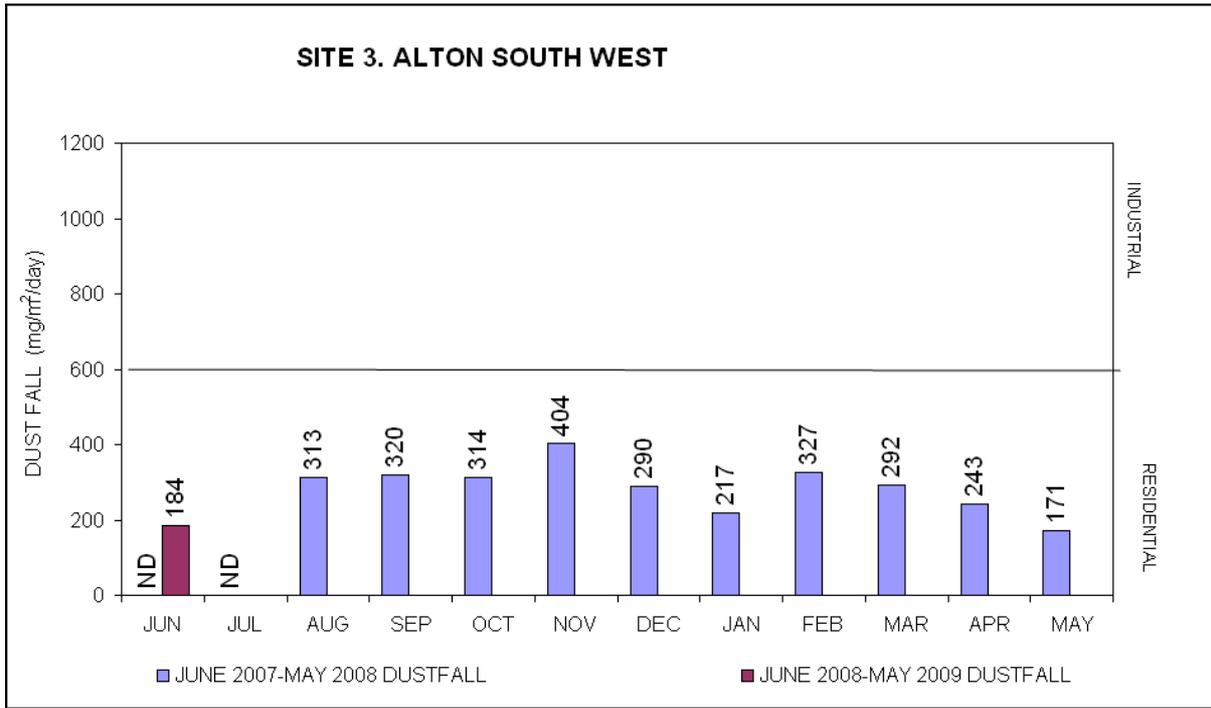

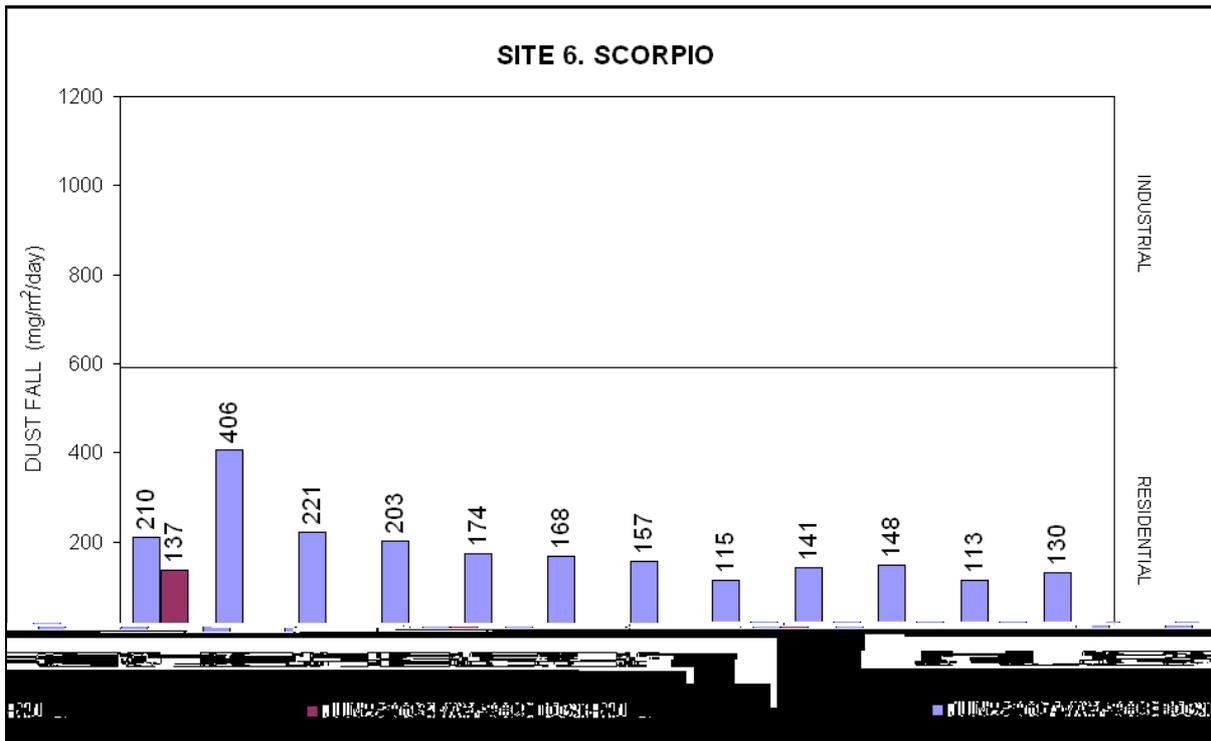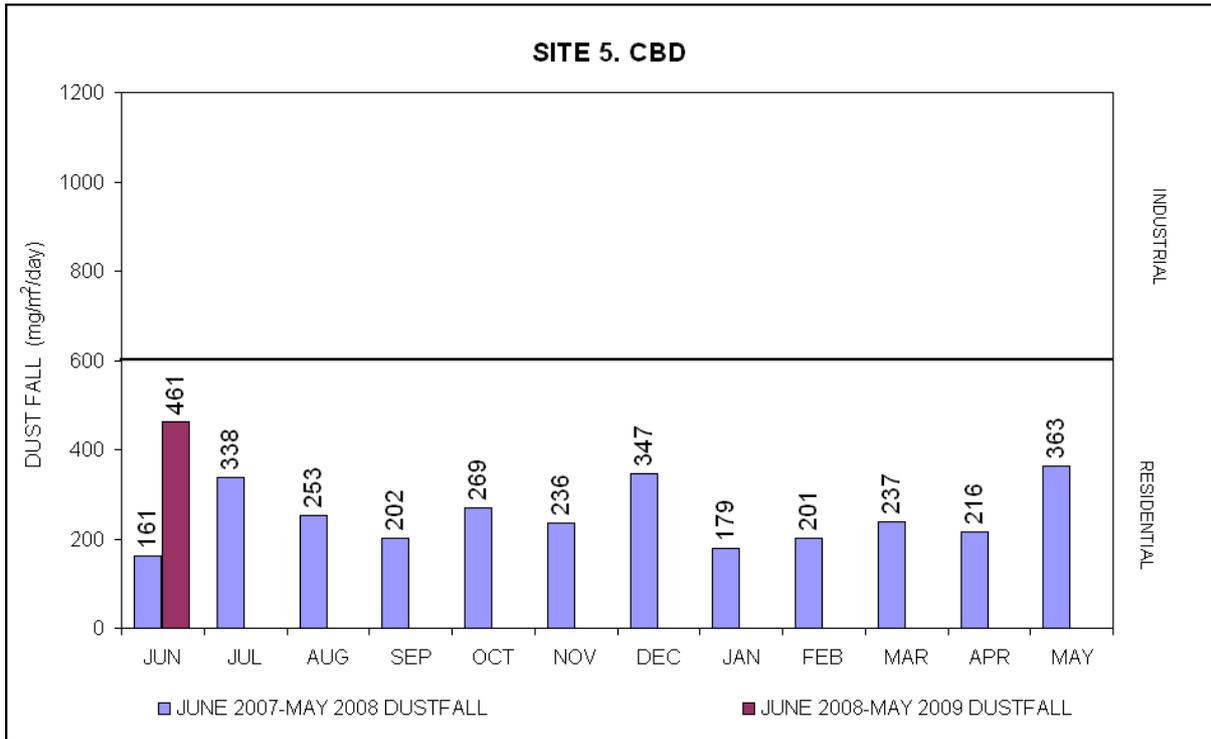

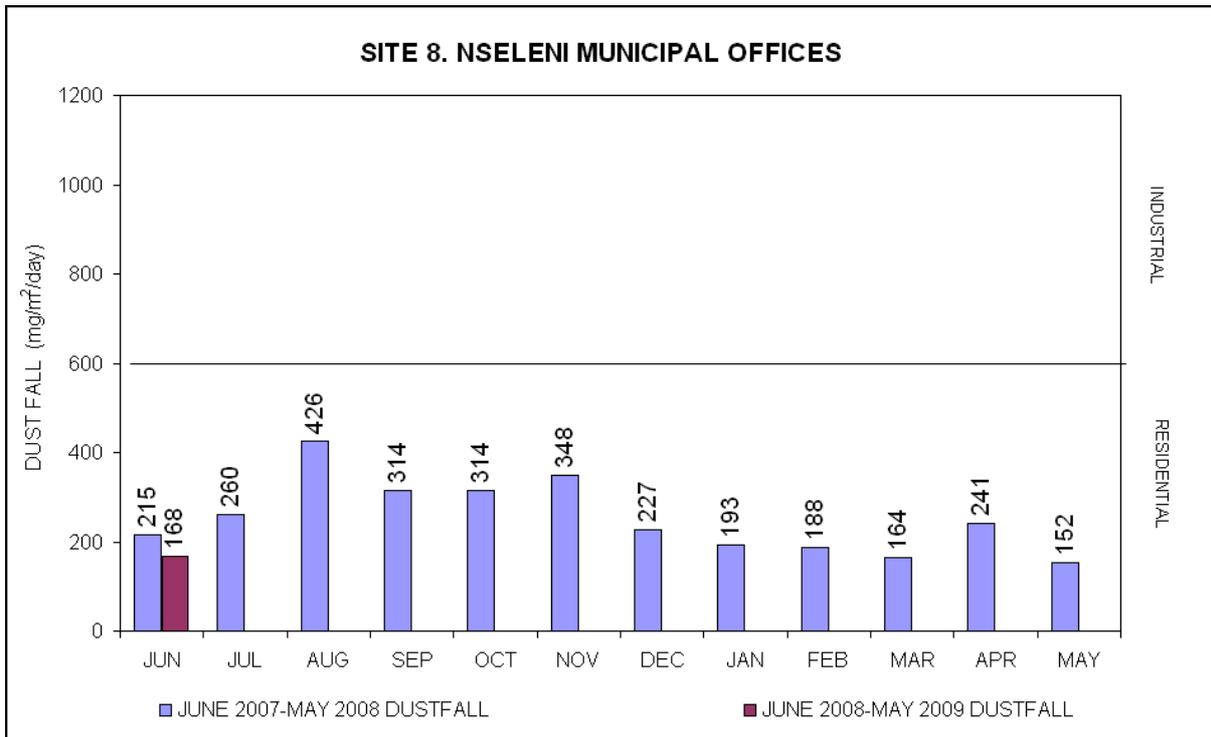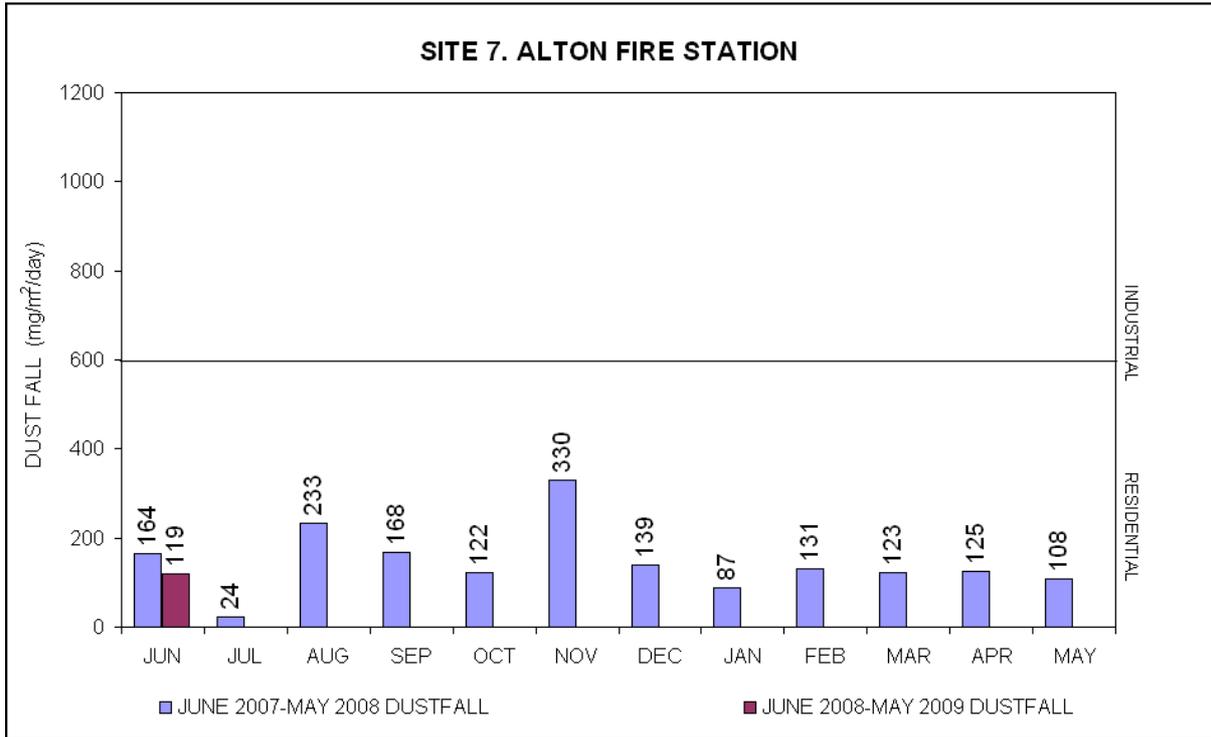

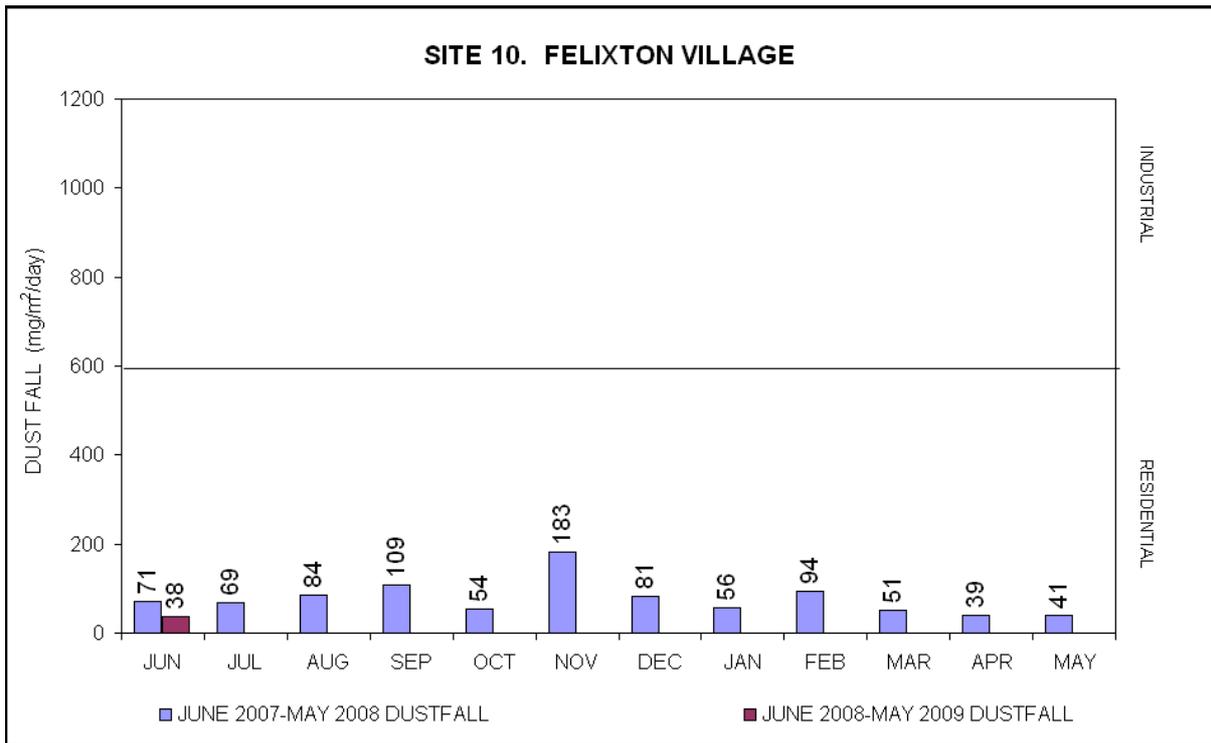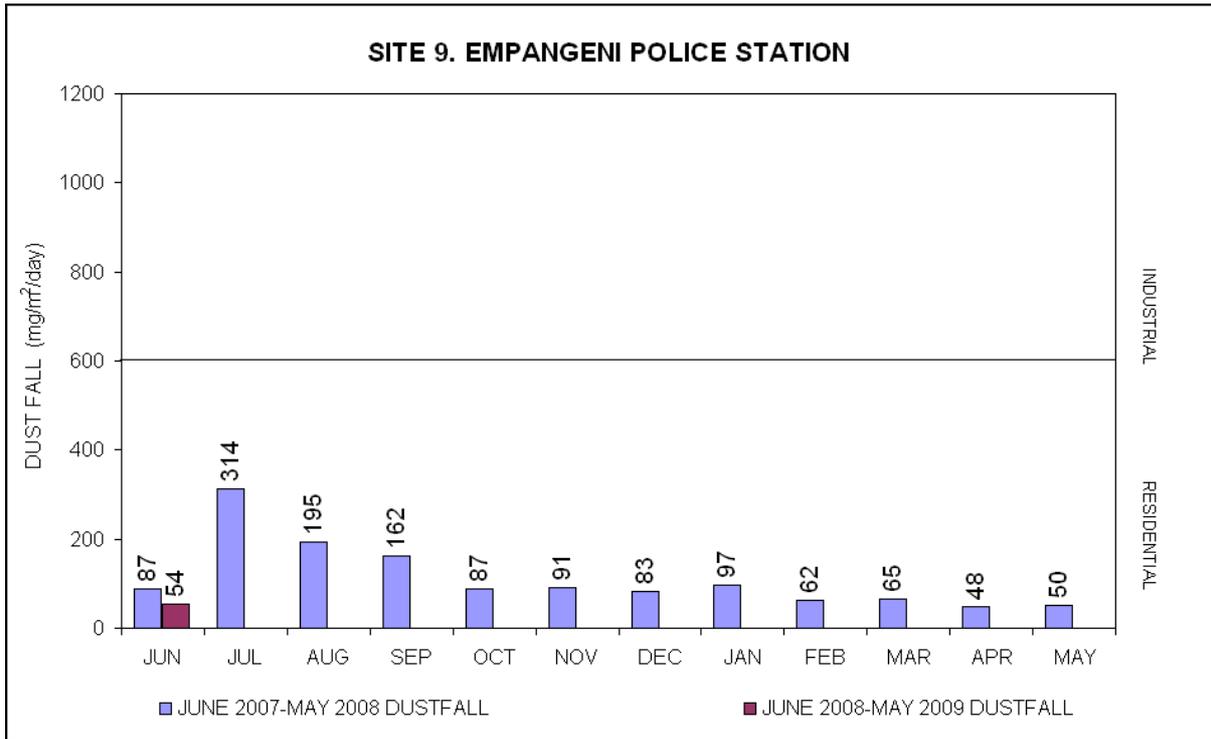

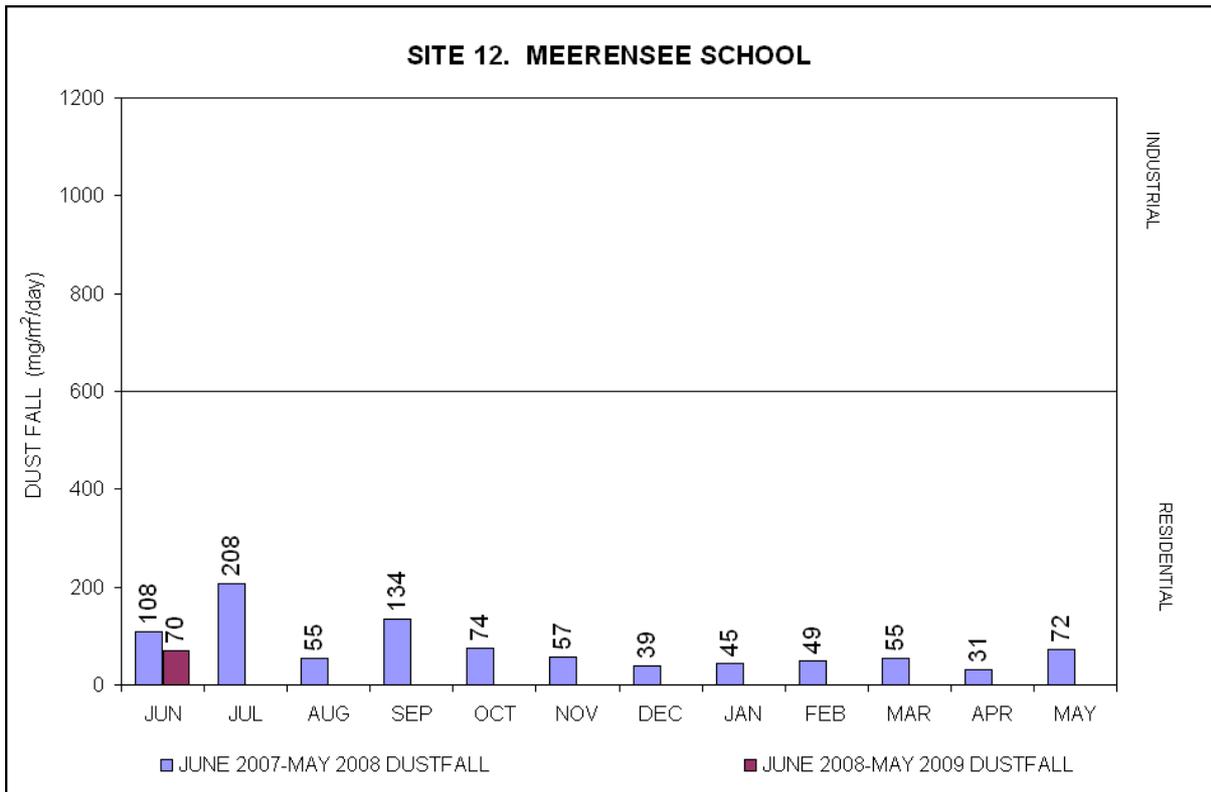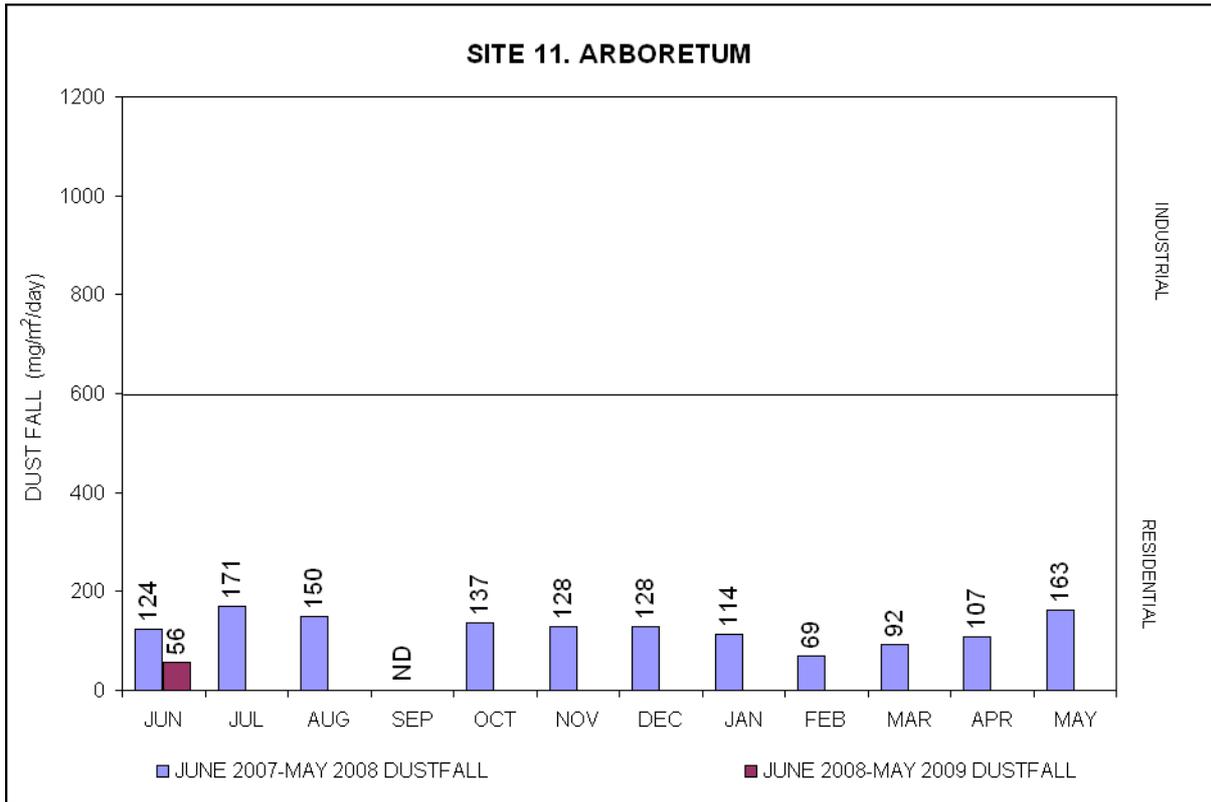

APPENDIX B: Sample Locations of all sites

